

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 1 of 14

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

KCB Supreme General Purpose Thinner

PROPER SHIPPING NAME

PAINT (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound)

PRODUCT USE

Also used to clean equipment; spray guns, paint lines, brushes, etc.

The use of a quantity of material in an unventilated or confined space may result in increased exposure and an irritating atmosphere developing.

Thinner for paints and for spray guns.

SUPPLIER

Company: KCB Sales

Address:

84 Camp Road

Broadmeadows

VIC, 3047

Australia

Telephone: +61 3 9457 1125

Emergency Tel: +61 3 9457 1125 (9am- 5pm)


Fax: +61 3 9459 7978

Section 2 - HAZARDS IDENTIFICATION

STATEMENT OF HAZARDOUS NATURE

HAZARDOUS SUBSTANCE. DANGEROUS GOODS. According to the Criteria of NOHSC, and the ADG Code.

CHEMWATCH HAZARD RATINGS

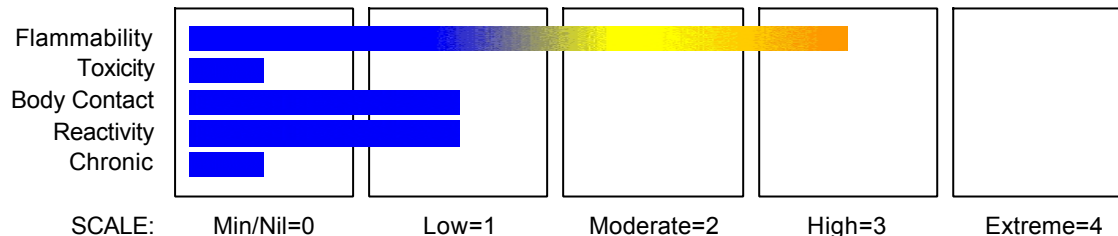

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 2 of 14

Section 2 - HAZARDS IDENTIFICATION

RISK

- Highly flammable.
 - HARMFUL- May cause lung damage if swallowed.
 - Ingestion may produce health damage*.
 - Cumulative effects may result following exposure*.
 - May produce discomfort of the respiratory system*.
 - Vapours potentially cause drowsiness and dizziness*.
- * (limited evidence).

SAFETY

- Keep away from sources of ignition. No smoking.
- Do not breathe gas/fumes/vapour/spray.
- Avoid contact with skin.
- Wear suitable protective clothing.
- Wear suitable gloves.
- Use only in well ventilated areas.
- Keep container in a well ventilated place.
- Do not empty into drains.
- To clean the floor and all objects contaminated by this material, use water and detergent.
- Keep away from food, drink and animal feeding stuffs.
- If swallowed, IMMEDIATELY contact Doctor or Poisons Information Centre. (show this container or label).
- This material and its container must be disposed of as hazardous waste.

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
aromatics, unspecified		30-60
ketones, unspecified		10-30
n- butyl acetate	123-86-4	1-10
alcohols, unspecified		1-10
No other ingredient information supplied.		

Section 4 - FIRST AID MEASURES

SWALLOWED

- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Seek medical advice.

EYE

- If this product comes in contact with the eyes:
- Wash out immediately with fresh running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- Seek medical attention without delay; if pain persists or recurs seek medical attention.

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet

Issue Date: 18-Nov-2013

A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 3 of 14

Section 4 - FIRST AID MEASURES

- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

- If skin contact occurs:
 - Immediately remove all contaminated clothing, including footwear.
 - Flush skin and hair with running water (and soap if available).
 - Seek medical attention in event of irritation.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor.

NOTES TO PHYSICIAN

Treat symptomatically.

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- Water spray or fog.
- Alcohol stable foam.
- Dry chemical powder.
- Carbon dioxide.

Do not use a water jet to fight fire.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- May be violently or explosively reactive.
- Wear breathing apparatus plus protective gloves in the event of a fire.
- Prevent, by any means available, spillage from entering drains or water course.
- Consider evacuation (or protect in place).
- Fight fire from a safe distance, with adequate cover.
- If safe, switch off electrical equipment until vapour fire hazard removed.
- Use water delivered as a fine spray to control the fire and cool adjacent area.
- Avoid spraying water onto liquid pools.
- Do not approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.

When any large container (including road and rail tankers) is involved in a fire, consider evacuation by 500 metres in all directions.

FIRE/EXPLOSION HAZARD

- Liquid and vapour are highly flammable.
- Severe fire hazard when exposed to heat, flame and/or oxidisers.
- Vapour may travel a considerable distance to source of ignition.
- Heating may cause expansion or decomposition leading to violent rupture of containers.
- On combustion, may emit toxic/ irritating fumes.

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 4 of 14

Section 5 - FIRE FIGHTING MEASURES

FIRE INCOMPATIBILITY

- Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result.

HAZCHEM

•3YE

Section 6 - ACCIDENTAL RELEASE MEASURES


MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.
- Control personal contact with the substance, by using protective equipment.
- Contain and absorb small quantities with vermiculite or other absorbent material.
- Wipe up.
- Collect residues in a flammable waste container.

MAJOR SPILLS

- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- May be violently or explosively reactive.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.
- Consider evacuation (or protect in place).
- No smoking, naked lights or ignition sources.
- Increase ventilation.
- Stop leak if safe to do so.
- Water spray or fog may be used to disperse /absorb vapour.
- Contain spill with sand, earth or vermiculite.
- Use only spark-free shovels and explosion proof equipment.
- Collect recoverable product into labelled containers for recycling.
- Absorb remaining product with sand, earth or vermiculite.
- Collect solid residues and seal in labelled drums for disposal.
- Wash area and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise emergency services.

PROTECTIVE ACTIONS FOR SPILL

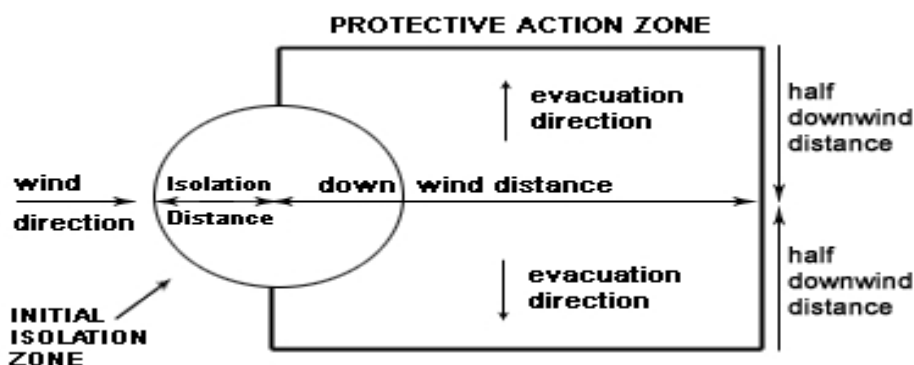

continued...

KCB Supreme General Purpose Thinner

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 18-Nov-2013

A317LP

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 5 of 14

Section 6 - ACCIDENTAL RELEASE MEASURES

From IERG (Canada/Australia)

Isolation Distance	25 metres
Downwind Protection Distance	300 metres
IERG Number	14

FOOTNOTES

1 PROTECTIVE ACTION ZONE is defined as the area in which people are at risk of harmful exposure. This zone assumes that random changes in wind direction confines the vapour plume to an area within 30 degrees on either side of the predominant wind direction, resulting in a crosswind protective action distance equal to the downwind protective action distance.

2 PROTECTIVE ACTIONS should be initiated to the extent possible, beginning with those closest to the spill and working away from the site in the downwind direction. Within the protective action zone a level of vapour concentration may exist resulting in nearly all unprotected persons becoming incapacitated and unable to take protective action and/or incurring serious or irreversible health effects.

3 INITIAL ISOLATION ZONE is determined as an area, including upwind of the incident, within which a high probability of localised wind reversal may expose nearly all persons without appropriate protection to life-threatening concentrations of the material.

4 SMALL SPILLS involve a leaking package of 200 litres (55 US gallons) or less, such as a drum (jerrican or box with inner containers). Larger packages leaking less than 200 litres and compressed gas leaking from a small cylinder are also considered "small spills".

LARGE SPILLS involve many small leaking packages or a leaking package of greater than 200 litres, such as a cargo tank, portable tank or a "one-tonne" compressed gas cylinder.

5 Guide 128 is taken from the US DOT emergency response guide book.

6 IERG information is derived from CANUTEC - Transport Canada.

EMERGENCY RESPONSE PLANNING GUIDELINES (ERPG)

The maximum airborne concentration below which it is believed that nearly all individuals could be exposed for up to one hour WITHOUT experiencing or developing

life-threatening health effects is:

n-butyl acetate 3000 ppm

irreversible or other serious effects or symptoms which could impair an individual's ability to take protective action is:

n-butyl acetate 200 ppm

other than mild, transient adverse effects without perceiving a clearly defined odour is:

n-butyl acetate 5 ppm*

American Industrial Hygiene Association (AIHA)

Ingredients considered according to the following cutoffs

Very Toxic (T+)	>= 0.1%	Toxic (T)	>= 3.0%
R50	>= 0.25%	Corrosive (C)	>= 5.0%
R51	>= 2.5%		
else	>= 10%		

where percentage is percentage of ingredient found in the mixture

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 6 of 14

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- Avoid smoking, naked lights, heat or ignition sources.
- When handling, DO NOT eat, drink or smoke.
- Vapour may ignite on pumping or pouring due to static electricity.
- DO NOT use plastic buckets.
- Earth and secure metal containers when dispensing or pouring product.
- Use spark-free tools when handling.
- Avoid contact with incompatible materials.
- Keep containers securely sealed.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately.
- Use good occupational work practice.
- Observe manufacturer's storage and handling recommendations contained within this MSDS.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions.

SUITABLE CONTAINER

- Packing as supplied by manufacturer.
- Plastic containers may only be used if approved for flammable liquid.
- Check that containers are clearly labelled and free from leaks.

STORAGE INCOMPATIBILITY

- Avoid reaction with oxidising agents.

STORAGE REQUIREMENTS

- Store in original containers in approved flame-proof area.
- No smoking, naked lights, heat or ignition sources.
- DO NOT store in pits, depressions, basements or areas where vapours may be trapped.
- Keep containers securely sealed.
- Store away from incompatible materials in a cool, dry well ventilated area.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storage and handling recommendations contained within this MSDS.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+



X



X



X



X



+

+: May be stored together

O: May be stored together with specific preventions

X: Must not be stored together

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 7 of 14

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

Source	Material	TWA ppm	TWA mg/m ³	STEL ppm	STEL mg/m ³	Peak ppm	Peak mg/m ³	TWA F/CC	Notes
Australia Exposure Standards	n- butyl acetate (n- Butyl acetate)	150		200	950				

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m ³)	Revised IDLH Value (ppm)
n-butyl acetate	8900	1,700 [LEL]

NOTES

Values marked LEL indicate that the IDLH was based on 10% of the lower explosive limit for safety considerations even though the relevant toxicological data indicated that irreversible health effects or impairment of escape existed only at higher concentrations.

ODOUR SAFETY FACTOR (OSF)

OSF=3.8E2 (n-BUTYLACETATE)

MATERIAL DATA

KCB SUPREME GENERAL PURPOSE THINNER:

N-BUTYL ACETATE:

Exposed individuals are reasonably expected to be warned, by smell, that the Exposure Standard is being exceeded.

Odour Safety Factor (OSF) is determined to fall into either Class A or B.

The Odour Safety Factor (OSF) is defined as:

OSF= Exposure Standard (TWA) ppm/ Odour Threshold Value (OTV) ppm

Classification into classes follows:

Class	OSF	Description
A	550	Over 90% of exposed individuals are aware by smell that the Exposure Standard (TLV- TWA for example) is being reached, even when distracted by working activities
B	26- 550	As "A" for 50- 90% of persons being distracted
C	1- 26	As "A" for less than 50% of persons being distracted
D	0.18- 1	10- 50% of persons aware of being tested perceive by smell that the Exposure Standard is being reached
E	<0.18	As "D" for less than 10% of persons aware of being tested

continued...

KCB Supreme General Purpose Thinner

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 18-Nov-2013

A317LP

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 8 of 14

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

KCB SUPREME GENERAL PURPOSE THINNER:

None assigned. Refer to individual constituents.

N-BUTYL ACETATE:

For n-butyl acetate

Odour Threshold Value: 0.0063 ppm (detection), 0.038-12 ppm (recognition)

Exposure at or below the recommended TLV-TWA is thought to prevent significant irritation of the eyes and respiratory passages as well as narcotic effects. In light of the lack of substantive evidence regarding teratogenicity and a review of acute oral data a STEL is considered inappropriate.

Odour Safety Factor(OSF)

OSF=3.8E2 (n-BUTYL ACETATE).

PERSONAL PROTECTION



EYE

- Safety glasses with side shields
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lenses or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent].

HANDS/FEET

- Wear general protective gloves, eg. light weight rubber gloves.

OTHER

- Overalls.
- PVC Apron.
- PVC protective suit may be required if exposure severe.
- Eyewash unit.
- Ensure there is ready access to a safety shower.

RESPIRATOR

- Type A Filter of sufficient capacity. (AS/NZS 1716 & 1715, EN 143:2000 & 149:2001, ANSI Z88 or national equivalent)

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 9 of 14

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

ENGINEERING CONTROLS

■ Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly effective in protecting workers and will typically be independent of worker interactions to provide this high level of protection.

The basic types of engineering controls are:

Process controls which involve changing the way a job activity or process is done to reduce the risk.

Enclosure and/or isolation of emission source which keeps a selected hazard "physically" away from the worker and ventilation that strategically "adds" and "removes" air in the work environment. Ventilation can remove or dilute an air contaminant if designed properly. The design of a ventilation system must match the particular process and chemical or contaminant in use.

Employers may need to use multiple types of controls to prevent employee overexposure.

For flammable liquids and flammable gases, local exhaust ventilation or a process enclosure ventilation system may be required. Ventilation equipment should be explosion-resistant.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Clear volatile highly flammable liquid with a typical odour; not miscible with water.

PHYSICAL PROPERTIES

Liquid.

Does not mix with water.

Floats on water.

State	Liquid	Molecular Weight	Not Applicable
Melting Range (°C)	Not Applicable	Viscosity	Not Available
Boiling Range (°C)	Not Available	Solubility in water (g/L)	Immiscible
Flash Point (°C)	- 17 (acetone)	pH (1% solution)	Not Applicable
Decomposition Temp (°C)	Not Available	pH (as supplied)	Not Applicable
Autoignition Temp (°C)	Not Available	Vapour Pressure (kPa)	Not Available
Upper Explosive Limit (%)	5.0	Specific Gravity (water=1)	0.78- 0.82
Lower Explosive Limit (%)	0.7	Relative Vapour Density (air=1)	Not Available
Volatile Component (%vol)	Not Available	Evaporation Rate	Not Available

Section 10 - STABILITY AND REACTIVITY

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

For incompatible materials - refer to Section 7 - Handling and Storage.

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 10 of 14

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

■ Not a likely route of entry into the body in commercial or industrial environments. The liquid may produce considerable gastrointestinal discomfort and be harmful or toxic if swallowed. Ingestion may cause nausea, pain and vomiting. Vomit entering the lungs by aspiration can cause inflammation of the lungs, which can lead to death.

EYE

■ The material may be irritating to the eye, with prolonged contact causing inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

SKIN

■ The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

INHALED

■ Not normally a hazard due to non-volatile nature of product.

Inhalation of high concentrations of gas/vapour causes lung irritation with coughing and nausea, central nervous depression with headache and dizziness, slowing of reflexes, fatigue and inco-ordination.

CHRONIC HEALTH EFFECTS

■ Principal routes of exposure are by accidental skin and eye contact and by inhalation of vapours especially at higher temperatures.

Long-term exposure to the product is not thought to produce chronic effects adverse to the health (as classified by EC Directives using animal models); nevertheless exposure by all routes should be minimised as a matter of course.

TOXICITY AND IRRITATION

KCB SUPREME GENERAL PURPOSE THINNER:

■ Not available. Refer to individual constituents.

N-BUTYL ACETATE:

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

TOXICITY

Oral (rat) LD50:13100 mg/kg

Dermal (rabbit) LD50:3200 mg/kg*

Inhalation (human) TClO:200 ppm

Inhalation (rat) LC50:2000 ppm/4h

Inhalation (Human) TClO:200 ppm/4h * [PPG]

Oral (Rat) LD50:10768 mg/kg

Inhalation (Rat) LC50:390 ppm/4h

Intraperitoneal (Mouse) LD50:1230 mg/kg

Oral (Rabbit) LD50:3200 mg/kg

Oral (Guinea pig) LD50:4700 mg/kg

Intraperitoneal (Guinea pig) LD:1500 mg/kg

■ The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

IRRITATION

Skin (rabbit):500 mg/24h- Moderate

Eye (rabbit):20 mg (open)- SEVERE

Eye (rabbit):20 mg/24h - Moderate

Eye (human):300 mg

continued...

KCB Supreme General Purpose Thinner

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 18-Nov-2013

A317LP

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 11 of 14

Section 11 - TOXICOLOGICAL INFORMATION

The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

SKIN

n- butyl acetate	GESAMP/EHS Composite List - GESAMP Hazard Profiles	D1: skin irritation/corrosion	0
------------------	--	-------------------------------	---

Section 12 - ECOLOGICAL INFORMATION

N-BUTYL ACETATE:

Fish LC50 (96hr.) (mg/l):	18
Daphnia magna EC50 (48hr.) (mg/l):	44
log Kow (Prager 1995):	1.82
Fish LC50 (96hr.) (mg/l):	100- 185
Daphnia magna EC50 (48hr.) (mg/l):	44
Algae IC50 (72hr.) (mg/l):	280
log Kow (Sangster 1997):	1.78
COD:	78%

For n-Butyl Acetate:

Koc: ~200;

log Kow: 1.78;

Half-life (hr) air: 144;

Half-life (hr) H2O surface water: 178 - 27156;

Henry's atm: m3 /mol: 3.20E-04

BOD 5 if unstated: 0.15-1.02,7%;

COD: 78%;

ThOD: 2.207;

BCF : 4-14.

Environmental Fate: Terrestrial Fate - Butyl acetate is expected to have moderate mobility in soil.

Volatilization of n-butyl acetate is expected from moist and dry soil surfaces. n-Butyl acetate may biodegrade in soil. Aquatic Fate: n-Butyl acetate is not expected to adsorb to suspended solids and sediment in water. Butyl acetate is expected to volatilize from water surfaces. Estimated half-lives for a model river and model lake are 7 and 127 hours respectively. Hydrolysis may be an important environmental fate for this compound. Atmospheric Fate: n-Butyl acetate is expected to exist solely as a vapour in the ambient atmosphere. Vapour-phase n-butyl acetate is degraded in the atmosphere by reaction with photochemically-produced hydroxyl radicals; the half-life for this reaction in air is estimated to be about 4 days.

Ecotoxicity: It is expected that bioconcentration in aquatic organisms is low. n-Butyl acetate is not acutely toxic to fish specifically, island silverside, bluegill sunfish, fathead minnow, and water fleas and has low toxicity to algae.

DO NOT discharge into sewer or waterways.

Ecotoxicity

Ingredient	Persistence: Water/Soil	Persistence: Air	Bioaccumulation	Mobility
n- butyl acetate	LOW	No Data Available	LOW	HIGH

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 12 of 14

Section 13 - DISPOSAL CONSIDERATIONS

- Consult manufacturer for recycling options and recycle where possible .
- Consult State Land Waste Management Authority for disposal.
- Incinerate residue at an approved site.
- Recycle containers if possible, or dispose of in an authorised landfill.

Section 14 - TRANSPORTATION INFORMATION



Labels Required: FLAMMABLE LIQUID

HAZCHEM:

•3YE (ADG7)

ADG7:

Class or Division:	3	Subsidiary Risk1:	None
UN No.:	1263	Packing Group:	II
Special Provision:	163 *	Limited Quantity:	5 L
Portable Tanks & Bulk Containers - Instruction:	T4	Portable Tanks & Bulk Containers - Special Provision:	TP1 TP8 TP28
Packagings & IBCs - Packing Instruction:	P001 IBC02	Packagings & IBCs - Special Packing Provision:	PP1

Name and Description: PAINT (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound) (see 3.2.5 for relevant [AUST.] entries)

Air Transport IATA:

ICAO/IATA Class:	3	ICAO/IATA Subrisk:	None
UN/ID Number:	1263	Packing Group:	II
Special provisions:	A3A72		
Cargo Only			
Packing Instructions:	364	Maximum Qty/Pack:	60 L
Passenger and Cargo			
Packing Instructions:	353	Maximum Qty/Pack:	5 L
Passenger and Cargo Limited Quantity			
Packing Instructions:	Y341	Maximum Qty/Pack:	1 L

Shipping name:PAINT (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound)

Maritime Transport IMDG:

IMDG Class:	3	IMDG Subrisk:	None
UN Number:	1263	Packing Group:	II

continued...

KCB Supreme General Purpose Thinner

Hazard Alert Code: HIGH

Chemwatch Material Safety Data Sheet

Issue Date: 18-Nov-2013

A317LP

CHEMWATCH 6554-43

Version No:4.1.1.1

Page 13 of 14

Section 14 - TRANSPORTATION INFORMATION

EMS Number: F-E,S-E Special provisions: 163

Limited Quantities: 5 L

Shipping name: PAINT (including paint, lacquer, enamel, stain, shellac, varnish, polish, liquid filler and liquid lacquer base) or PAINT RELATED MATERIAL (including paint thinning or reducing compound)

Section 15 - REGULATORY INFORMATION

Indications of Danger:

F Highly Flammable

Xn Harmful

POISONS SCHEDULE

S5

REGULATIONS

Regulations for ingredients

n-butyl acetate (CAS: 123-86-4) is found on the following regulatory lists;

"Acros Transport Information", "Australia - Victoria Occupational Health and Safety Regulations - Schedule 9: Materials at Major Hazard Facilities (And Their Threshold Quantity) Table 2", "Australia Exposure Standards", "Australia Hazardous Substances Information System - Consolidated Lists", "Australia High Volume Industrial Chemical List (HVICL)", "Australia Inventory of Chemical Substances (AICS)", "Australia National Pollutant Inventory", "FisherTransport Information", "GESAMP/EHS Composite List - GESAMP Hazard Profiles", "IMO IBC Code Chapter 17: Summary of minimum requirements", "IMO MARPOL 73/78 (Annex II) - List of Noxious Liquid Substances Carried in Bulk", "International Council of Chemical Associations (ICCA) - High Production Volume List", "International Fragrance Association (IFRA) Survey: Transparency List", "IOFI Global Reference List of Chemically Defined Substances", "OECD List of High Production Volume (HPV) Chemicals", "OSPAR National List of Candidates for Substitution – Norway", "Sigma-AldrichTransport Information"

No data for KCB Supreme General Purpose Thinner (CW: 6554-43)

Section 16 - OTHER INFORMATION

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net/references.

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

continued...

KCB Supreme General Purpose Thinner

Chemwatch Material Safety Data Sheet
Issue Date: 18-Nov-2013
A317LP

Hazard Alert Code: HIGH

CHEMWATCH 6554-43
Version No:4.1.1.1
Page 14 of 14

Section 16 - OTHER INFORMATION

Issue Date: 18-Nov-2013
Print Date: 8-Apr-2014

This is the end of the MSDS.